3/71

COMPLETION REPORT

41 24 38 73 43 19

LAKE CARMEL

PUTNAM COUNTY DEPARTMENT OF HEALTH
Division of Environmental Health Services
COUNTY OFFICE BUILDING - CARMEL, NEW YORK

This report is to be completed by well driller and submitted to County Health Department together with laboratory report of analysis of water sample indicating water is of satisfactory bacterial quality before certificate of construction compliance is issued.

REPORT MUST BE SUBMITTED WITHIN 30 DAYS OF WELL COMPLETION

P919

OWNER	NAME: Richard Guzzi		ADDRESS: 24 Myrtle-Dale Road, Scarsdale, N.Y.	
LOCATION OF WELL	(No. & Street): XXXXXXXXXX Fini Drive		(Town): Mahopac, New York	(Lot Number): 9
PROPOSED USE OF WELL	[X] DOMESTIC; [ ] BUSINESS ESTABLISHMENT; [ ] FARM; [ ] TEST WELL; [ ] PUBLIC SUPPLY; [ ] INDUSTRIAL; [ ] AIR CONDITIONING; [ ] OTHER (Specify)			750 H
DRILLING EQUIPMENT	[ ] ROTARY; [XX] COMPRESSED AIR PERCUSSION; [ ] CABLE PERCUSSION; [ ] OTHER (Specify)			
CASING DETAILS	LENGTH (feet): 50	DIAMETER (inches): 6	WEIGHT PER FOOT: 17	[XX] THREADED [ ] WELDED; DRIVE SHOE: [X] YES [ ] NO; WAS CASING CEMENTED: [X] YES [ ] NO
YIELD TEST	[ ] BAILED; [ ] PUMPED; [X] COMPRESSED AIR	HOURS: 3	G.P.M.: 5	YIELD (G.P.M.): 5
WATER LEVEL	MEASURE FROM LAND SURFACE—STATIC (Specify feet): 10	DURING YIELD TEST (feet): 275	Depth of Completed Well in feet below Land surface: 275	
SCREEN DETAILS	MAKE			LENGTH OPEN TO AQUIFER (feet)
	SLOT SIZE	DIAMETER (inches)	IF GRAVEL PACKED: Diameter of well including gravel pack (inches):	GRAVEL SIZE (inches) FROM (feet) TO (feet)

DEPTH FROM LAND SURFACE FEET	TO FEET	FORMATION DESCRIPTION
0	40	Hardpan & boulders.
40	45	Weathered ledge.
45	275	Hard gray granite.

Sketch exact location of well with distances, to at least two permanent landmarks.

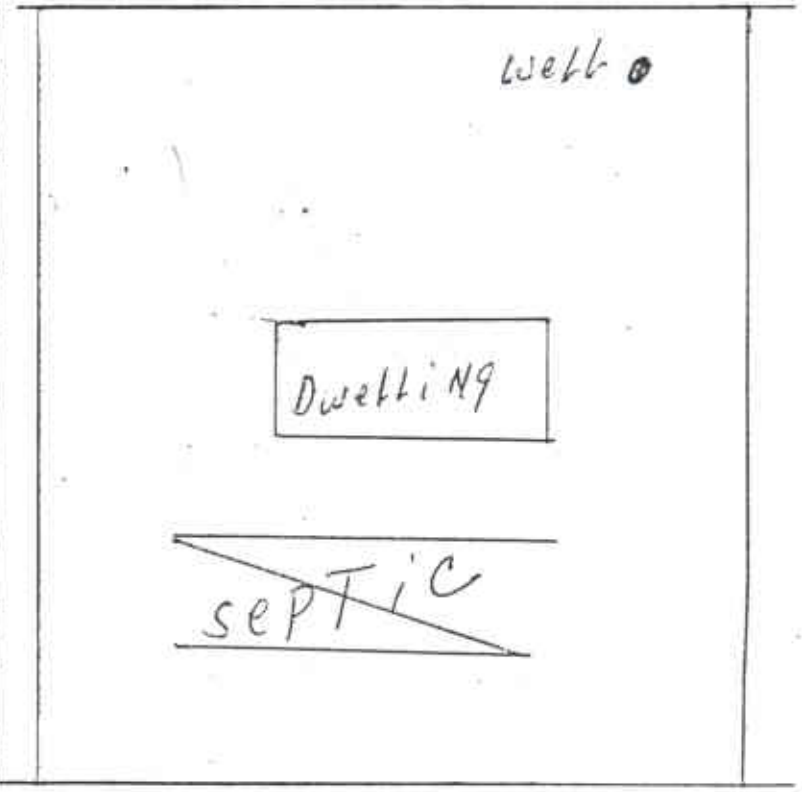

If yield was tested at different depths during drilling, list below

FEET	GALLONS PER MINUTE
215	2
260	4

WELL COMPLETED	DATE OF REPORT	WELL DRILLER (Signature)
7/73	7/14/73	Robert M Mill President MILL DRILLING, INC.