C232 Mohegan

Division of Environmental Health Services
COUNTY OFFICE BUILDING - CARMEL, NEW YORK

This report is to be completed by well driller and submitted to County Health Department together with laboratory report of analysis of water sample indicating water is of satisfactory bacterial quality before certificate of construction compliance is issued.

REPORT MUST BE SUBMITTED WITHIN 30 DAYS OF WELL COMPLETION

P983

OWNER	NAME Santino Homes, Inc.		ADDRESS Dahlia Drive, Mahopac, NY 10541	
LOCATION OF WELL	(No. & Street) Ridge Road		(Town) Mahopac, New York	(Lot Number)
PROPOSED USE OF WELL	[X] DOMESTIC	[ ] BUSINESS ESTABLISHMENT	[ ] FARM	[ ] TEST WELL 590 S
	[ ] PUBLIC SUPPLY	[ ] INDUSTRIAL	[ ] AIR CONDITIONING	[ ] OTHER (Specify)
DRILLING EQUIPMENT	[ ] ROTARY	[X] COMPRESSED AIR PERCUSSION	[ ] CABLE PERCUSSION	[ ] OTHER (Specify)

CASING DETAILS	LENGTH (feet)	DIAMETER (inches)	WEIGHT PER FOOT	[X] THREADED [ ] WELDED	DRIVE SHOE [X] YES [ ] NO	WAS CASING GROUTED? [X] YES [ ] NO
	146	6	19			

YIELD TEST	[ ] BAILED	[ ] PUMPED	[X] COMPRESSED AIR	HOURS	G.P.M.	YIELD (G.P.M.)
				4	30	30

WATER LEVEL	MEASURE FROM LAND SURFACE — STATIC (Specify feet)	DURING YIELD TEST (feet)	Depth of Completed Well in feet below land surface:
	20	265	265

SCREEN DETAILS	MAKE				LENGTH OPEN TO AQUIFER (feet)	
	SLOT SIZE	DIAMETER (inches)	IF GRAVEL PACKED:	Diameter of well including gravel pack (inches):	GRAVEL SIZE (inches)	FROM (feet) / TO (feet)

DEPTH FROM LAND SURFACE: FEET	to FEET	FORMATION DESCRIPTION
0	116	Hardpan & boulders
116	136	Brown weathered ledge
136	265	Hard grey & black granite

If yield was tested at different depths during drilling, list below

FEET	GALLONS PER MINUTE
245	5
265	30

Sketch exact location of well with distances to at least two permanent landmarks.

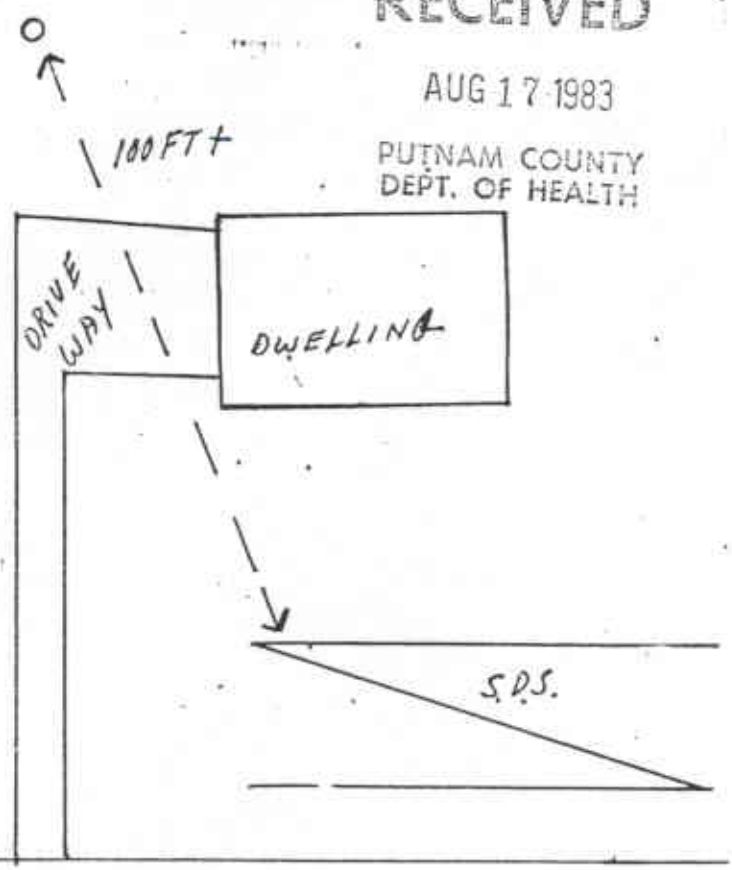

RECEIVED
AUG 17 1983
PUTNAM COUNTY DEPT. OF HEALTH

DATE WELL COMPLETED	DATE OF REPORT	WELL DRILLER (signature)
7/14/83	7/19/83	Robert M Mill President-MILL DRILLING, INC.