3/71

6255 CROTON FALLS

Division of Environmental Health Services
COUNTY OFFICE BUILDING - CARMEL, NEW YORK

This report is to be completed by well driller and submitted to County Health Department together with laboratory report of analysis of water sample indicating water is of satisfactory bacterial quality before certificate of construction compliance is issued.

REPORT MUST BE SUBMITTED WITHIN 30 DAYS OF WELL COMPLETION

P994

41 22 00 73 42 45

OWNER	NAME: Santino Homes	ADDRESS: Dahlia Drive, Mahopac, New York
LOCATION OF WELL	(No. & Street): Watermelon Hill Road	(Town): Mahopac, New York (Lot Number):
PROPOSED USE OF WELL	[X] DOMESTIC; [ ] BUSINESS ESTABLISHMENT; [ ] FARM; [ ] TEST WELL; [ ] PUBLIC SUPPLY; [ ] INDUSTRIAL; [ ] AIR CONDITIONING; [ ] OTHER (Specify)	670 C
DRILLING EQUIPMENT	[ ] ROTARY; [X] COMPRESSED AIR PERCUSSION; [ ] CABLE PERCUSSION; [ ] OTHER (Specify)	
CASING DETAILS	LENGTH (feet): 170; DIAMETER (inches): 6; WEIGHT PER FOOT: 17; [X] THREADED [ ] WELDED; DRIVE SHOE: [X] YES [ ] NO; WAS CASING GROUTED? [ ] YES [X] NO	
YIELD TEST	[ ] BAILED [ ] PUMPED [X] COMPRESSED AIR; HOURS: 4; G.P.M.: 5; YIELD (G.P.M.): 5	
WATER LEVEL	MEASURE FROM LAND SURFACE—STATIC (Specify feet): 105; DURING YIELD TEST (feet): 600	Depth of Completed Well in feet below Land surface: 600
SCREEN DETAILS	MAKE: ; LENGTH OPEN TO AQUIFER (feet): ; SLOT SIZE: ; DIAMETER (inches): ; IF GRAVEL PACKED: Diameter of well including gravel pack (inches): ; GRAVEL SIZE (inches): ; FROM (feet): ; TO (feet):	

DEPTH FROM LAND SURFACE FEET	to FEET	FORMATION DESCRIPTION
0	154	Grey hardpan
154	160	Brown weathered ledge
160	600	Hard grey & black granite

Sketch exact location of well with distances, to at least two permanent landmarks.

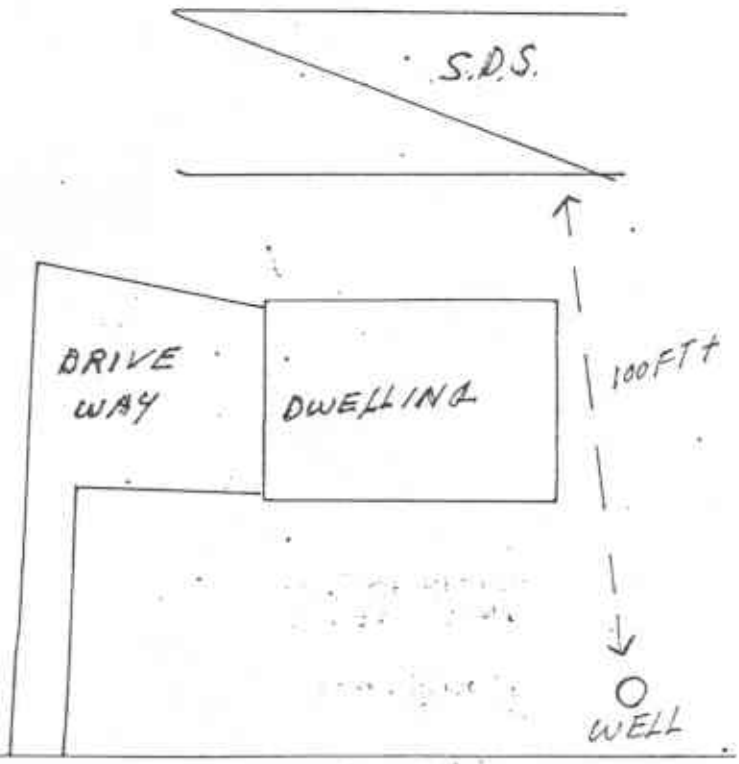

If yield was tested at different depths during drilling, list below

FEET	GALLONS PER MINUTE
400	1
600	5

DATE WELL COMPLETED	DATE OF REPORT	WELL DRILLER (Signature)
8/1/83	8/15/83	Robert M. Mill Robert M. Mill-MILL DRILLING, INC